

# Cable-Extension Position Transducer

0/4...20 mA Output

Ranges: 0-2 to 0-50 inches

Compact Size • OEM Applications



# PT1MA

## Specification Summary:

### GENERAL

Full Stroke Range Options ..... 0-2 to 0-50 inches  
 Output Signal Options ..... 4...20 mA (2-wire) and 0...20 mA (3-wire)  
 Accuracy .....  $\pm 0.28\%$  to  $\pm 0.15\%$  full stroke *see ordering information*  
 Repeatability .....  $\pm 0.05\%$  full stroke  
 Resolution ..... essentially infinite  
 Measuring Cable ..... .019-in. dia. nylon-coated stainless steel  
 Enclosure Material ..... glass-filled polycarbonate and black anodized aluminum  
 Sensor ..... plastic-hybrid precision potentiometer  
 Potentiometer Cycle Life ..... *see ordering information*  
 Maximum Retraction Acceleration ..... *see ordering information*  
 Weight ..... 1 lb. max.

### ELECTRICAL

Input Voltage ..... *see ordering information*  
 Input Current ..... .20 mA max.  
 Maximum Loop Resistance (Load) ..... (loop supply voltage - 8)/0.020  
 Circuit Protection ..... .38 mA max.  
 Impedance ..... 100M ohms@100 VDC, min.  
 Output Signal Adjustment  
 Zero Adjustment ..... from factory set zero to 50% of full stroke range  
 Span Adjustment ..... to 50% of factory set span  
 Thermal Effects  
 Zero ..... 0.01% f.s./°F, max.  
 Span ..... 0.01% f.s./°F, max.

### ENVIRONMENTAL

Enclosure ..... NEMA 4, IP 65  
 Operating Temperature ..... 0° to 200°F (-17° to 90°C)  
 Vibration ..... up to 10 G's to 2000 Hz maximum


### EMC COMPLIANCE PER DIRECTIVE 89/336/EEC

Emission/Immunity ..... EN50081-2/EN50082-2




The PT1MA adds 4...20 mA position feedback signal to Celesco's compact line of cable-extension transducers. The PT1MA is available with full stroke ranges from as little as 2 inches on up to 50 inches with adjustable zero and span settings to precisely match the full scale output to your exact measurement range.

The PT1MA offers several options including forward and reverse 0...20 and 4...20 mA output signals, alternate measuring cable exits and a couple different electrical connection options.

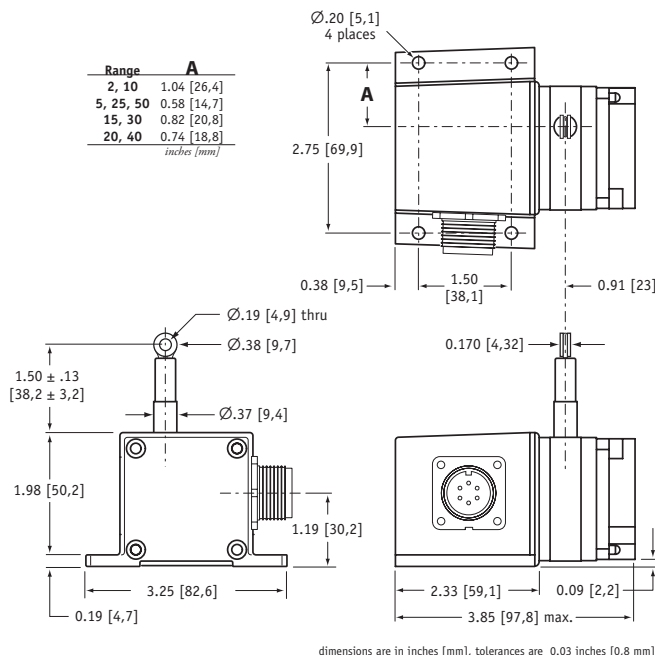

## Output Signal

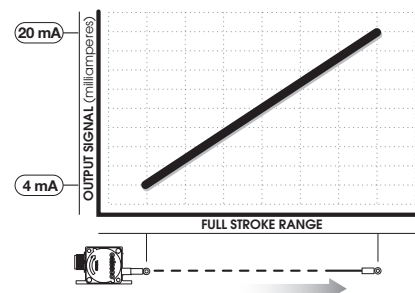

**Ordering Information:**

**Model Number:**

**PT1MA** - \_\_\_\_\_ - \_\_\_\_\_ - \_\_\_\_\_ - \_\_\_\_\_ - \_\_\_\_\_  
*order code:*                    **R**                    **A**                    **B**                    **C**                    **D**

Sample Model Number:

**PT1MA - 30 - UP - 420E - MC4 - SG**

- R** range: 30 inches
- A** measuring cable exit: up
- B** output signal: 4...20mA
- C** electrical connection: 4-pin micro connector
- D** cable guide: spring-loaded guide

**Full Stroke Range:**

<b>R</b> order code:	2	5	10	15	20	25	30	40	50
full stroke range, min:	2 in.	5 in.	10 in.	15 in.	20 in.	25 in.	30 in.	40 in.	50 in.
accuracy (% of f.s.):	0.28%		0.18%			0.15%			
potentiometer cycle life:	2,500,000 cycles		500,000 cycles			250,000 cycles			
cable tension (20%):	12 oz.	5 oz.	12 oz.	9 oz.	6 oz.	5 oz.	9 oz.	6 oz.	5 oz.
maximum cable acceleration:	11 G's	3 G's	11 G's	5 G's	4 G's	3 G's	5 G's	4 G's	3 G's

**Cable Exit:**

**A** order code: direction:                    **UP**                    **DN**                    **FR**                    **BK**  
 up                    down                    front                    back

measurement range	2	5	10	15	20	25	30	40	50
<b>A</b>	1.04 in. 26,4 mm	0.58 in. 14,7 mm	1.04 in. 26,4 mm	0.82 in. 20,8 mm	0.74 in. 18,8 mm	0.58 in. 14,7 mm	0.82 in. 20,8 mm	0.74 in. 18,8 mm	0.58 in. 14,7 mm
<b>B</b>	0.75 in. 19,1 mm	0.29 in. 6,1 mm	0.75 in. 19,1 mm	0.53 in. 13,5 mm	0.45 in. 11,5 mm	0.29 in. 6,1 mm	0.53 in. 13,5 mm	0.45 in. 11,5 mm	0.29 in. 6,1 mm
<b>C</b>	1.43 in. 36,3 mm	1.89 in. 48,0 mm	1.43 in. 36,3 mm	1.65 in. 41,9 mm	1.73 in. 43,9 mm	1.89 in. 48,0 mm	1.65 in. 41,9 mm	1.73 in. 43,9 mm	1.89 in. 48,0 mm

**Output Signals:**

<b>B</b> order code:	420E	420R	020E	020R
output signal options:	4...20 mA	20...4 mA	0...20 mA	20...0 mA
sensitivity:	16 mA/full stroke ±0.25%		20 mA/full stroke ±0.25%	
wiring configuration:	2 - wire		3 - wire	
input voltage:	8 - 34 vdc		14 - 29 vdc	


example:

ordercode = **420E** = 4...20 mA →  
 4 mA =   
 20 mA =

**Ordering Information (cont.)**

**Electrical Connection:**

④ *order code:*

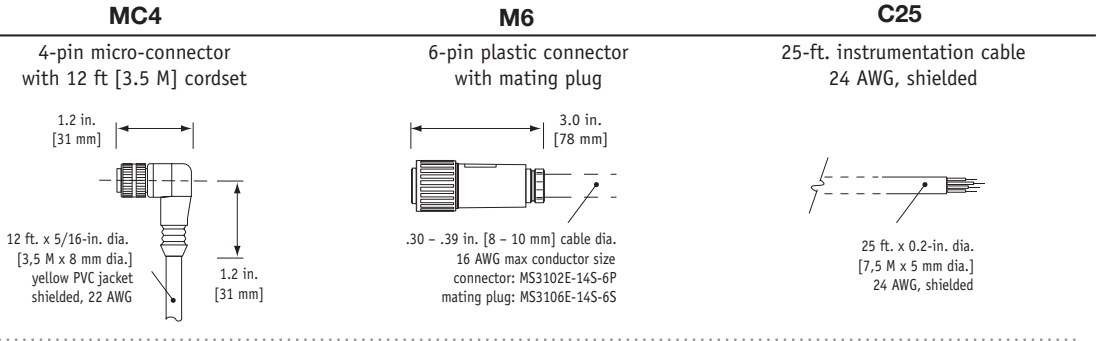

**4-pin mating plug and cordset:**

pin	color code	2-wire	3-wire
1	RED-BLK TR.	8...34 vdc	14...29 vdc common
2	RED-WHT TR.	4...20 mA	0...20 mA
3	RED	-	-
4	GREEN	-	-

**6-pin mating plug:**

pin	2-wire	3-wire
A	8...34 vdc	14...29 vdc common
B	4...20 mA	0...20 mA
C	-	-
D	-	-

**25-ft. cable:**

color code	2-wire	3-wire
RED	8...34 vdc	14...29 vdc common
BLACK	4...20 mA	-
WHITE	-	-
GREEN	-	0...20 mA

**Cable Guide:**



① *order code:*

**blank**  
standard cable guide

**SG**  
spring-loaded guide

*cable-guide cushions impact from accidental free release*



北京赛斯维测控技术有限公司  
北京市朝阳区望京西路48号  
金隅国际C座1002  
电话：+86 010 8477 5646  
传真：+86 010 5894 9029  
邮箱：[sales@sensorway.cn](mailto:sales@sensorway.cn)  
<http://www.sensorway.cn>

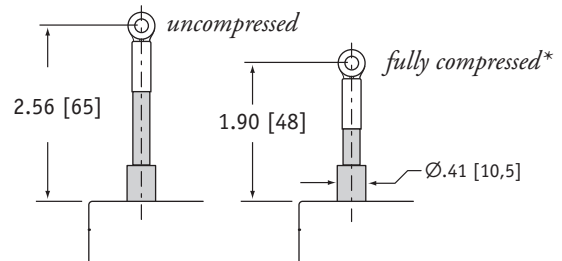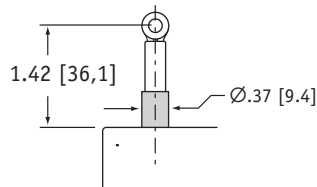

*\*note: start of full stroke range begins at full compression point (except 2-inch and 5-inch ranges).*

**Output Signal Selection:**

The output signal direction can be reversed at any time by simply changing the dip-switch settings found on the internal signal board. After the settings have been changed, adjustment of the Zero and Span trimpots will be required to precisely match signal values to the beginning and end points of the stroke.

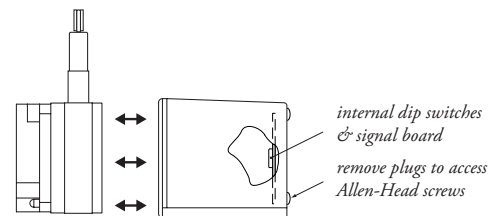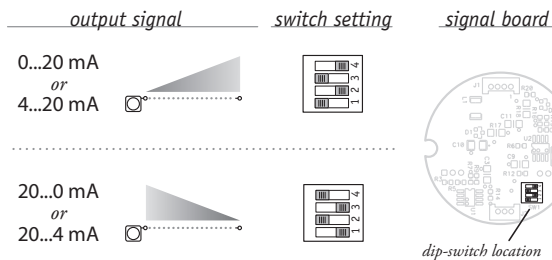

to gain access to the signal board, remove the two Allen-Head Screws and remove rear cover.

version: 8.0 last updated: May 21, 2013